

Ricoh® 4150 Belt Replacement



Oasis Imaging Products, Inc. Technical Support: (888) 627-6555

Recommended Tools:

Phillips screwdriver
Small flat head screwdriver

Approximate Remanufacturing Time:

15-20 min.

Instructions:

1. Remove two screws on corona assembly. The corona grid unit has spring tension and can be removed by pushing it to the left and then lifting it off (Fig. 1).
2. Remove four screws on bottom of belt housing (Fig. 2).
 - a. Lift cover off carefully.
 - b. Note position of wire springs.
3. Remove the two spring assemblies.
4. Lift belt assembly up and out of housing and remove belt.
5. Vacuum and clean housing of all loose toner.
6. Slide new belt on, return belt assembly to housing.
7. Put springs back on shaft, hold cover up at angle (spring rods fit into grooves in housing).
8. Replace housing and secure with four screws.
9. Replace corona grid and secure with two screws.

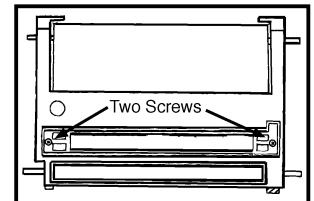


Figure 1

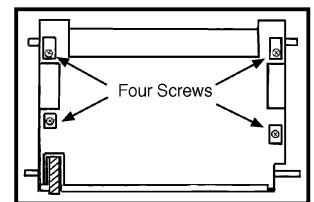


Figure 2

Printer Compatibility:

ACOM COMPUTER CHECKMASTER

MICR, LX3815, MC3815

ADVANCED TECH INTL LASERPRINT

1500, 1570

AEDEX CORP LASERBAR-615

LASER PLUS

BOTTOMLINE TECH BT 5015 MICR

BURROUGHS AP 9215

BUSINESS SYS INTL LASERSOFT

PRINT II

COMPUTER LANGUAGE RES

FORMWRITER 8

CSS LAB OAW 153

DECISION DATA 6415

DELL COMPUTER LASER SYSTEM 150

DIGITAL DESIGN CHECK PTR 656 MICR,

LASER SYS PLUS 171

ELECTRONIC FORMS SYS

LASERCHECK MICR, SYS 8

FACIT OPUS 3, P 1750-OPUS 3

GBT 6625 LM, 6625 XP

HONEYWELL MODEL 85, PRU 7265

PRU 7266, PRU 7267, PRU 7665

PRU 7666, PRU 7667, 9965

PRU 9966, PRU 9967

ITT COURIER 9375, 9376, 9375

9376

LANIER LS-15

LASERSOFT PT. SYS II

MEMOREX 1815-1

MEMOREX 1815-2, 2115-B, 2115-BT

MITEK SYSTEMS MODEL 150T, 2150

NBS SOUTHERN SYSTEMS 3815

NCR 6436, 6436-0201

6436-0301, 6436-0501 POSTSCRIPT

OASYS LASERPRO 1510 MICR

5215, 5315

OCE 6130, 6137

PC'S LTD LASERIMAGE 150

PERSONAL COMP LASERIMAGE 3000,

3000-3X, 3020-ID, 3020-IS, 3020-LN03,

3020-PP

QMS LASERGRAFIX 1500, 1510

QMS MAGNUM LP-15, PS 1500

QMS SMARTWRITER 150, 150 PLUS

RICOH LP 3150, 4150, 4150 FLEX

4150 R2, PC LASER 15/EX

SIEMENS ND 2015

SYNTRIX SYNJET

TALARIS SYSTEMS T-1500, T-1502

T-1590, T-1590LN, T-1590PC, T-PRTSTN

TI OMNILASER 2015, 2115

TROY 315 MICR

US LYNX LYNXLASER

UNISYS AP 9215, AP 9215-1

AP 9415

WALLACE COMP SERV TI 2115

WANG LCS15, LCS15-CMB

LCS15-DSK, LCS15-SYS

LCS15-T

XPOINT CORP XP